

# ENGINEERING PRODUCTS FOR THE FUTURE



## TUBE PRODUCTS OF INDIA SHIRWAL

30X28 – Crack sample analysis and Action Plan. Saptagiri Industries Pvt Ltd, Aurangabad.



#### **Complaint details**



## Customer Name: M/s. Saptagiri Industries Pvt. Ltd. Location: Aurangabad.

Defect :- Weld Crack.

Size :- 30X28X4650.

Complaint Date :- 22<sup>nd</sup> Nov-2024.

Invoice No. 3048010001064.

Supplied Date – 05.11.24.

Supplied Qty - 6305.0Mtrs.

Plant Invoice No. - PSH-LST-19624 & 19628.


Supplied Date – 28<sup>th</sup> & 29<sup>th</sup> Nov-2024.

Date of sample received :- 26th Nov-2024.




## **Defective Sample photos**




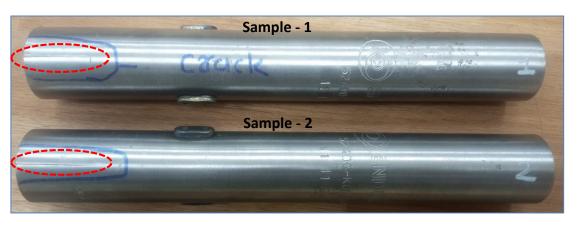



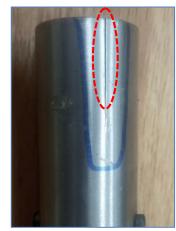



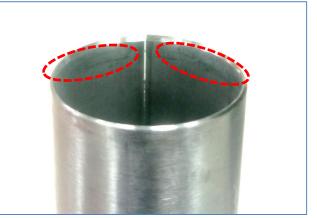





#### **Observations:**-

- 1) Crack observed to received samples.
- 2) Pressing mark observed at crack side.
- 3) Batch code date 11.11.2024.



## Chemistry



Elements	%C	% Mn	%S	%P	%Si	%Al
Spec	0.12 Max	0.60 Max	0.04 Max	0.04 Max	-	-
Sample-1	0.0876	0.527	0.0146	0.0163	0.005	0.0411
Sample-2	0.0943	0.524	0.0153	0.0175	0.005	0.0415

#### **Observations:**-

1) Chemical composition observed within specification.



## Failed Sample-1 Weld flow analysis



#### Sample photo



Micro@A-Weld-25x	Micro@B-Weld-25x	Micro@C-Weld-25x	
200 <u>un</u> ,	1.200 ml	200 µm,	
Crack observed on weld line.	Weld flow observed ok	Weld flow observed ok	



## Failed Sample-2 Weld flow analysis



#### Sample photo



Micro@A-Weld-25x	Micro@B-Weld-25x	Micro@C-Weld-25x	
- 100 FeV	200 hul	200 un.	
Crack observed on weld line.	Weld flow observed ok	Weld flow observed ok	



### (WHY-WHY ANALYSIS)



#### Root cause establishment (Why-Why Analysis) - Occurrence

WHY – 1	WHY- 2	WHY -3	WHY-4	Why-5
Weid (rack	Insufficient fusion during squeezing and welding.	Less heat at localized area.		Sizing gear box Coupling chain broken.

#### Root cause establishment (Why-Why Analysis) - Detection

WHY – 1	WHY- 2	WHY -3	WHY-4	Why-5
Weld crack.	Tube got opened during welding assembly pressing operation at Endurance end.	Less bonding strength.	Not detected in online ECT.	Weld was intact.



## **Action Plan**



Occurrence Side Action					
Sr. No	Cause	Cause Countermeasure		Status	
1	Sizing gear box Coupling chain broken.	1. Chain and coupling to be replaced annually and point added in TBM Schedule .	26 <sup>th</sup> Nov-2024	Completed.	
Detection Side Action					
1	Detection.	1. Disposal action Point added in stoppage matrix to take care during Such stoppage.	26 <sup>th</sup> Nov-2024	Added.	





## Thank you!



#### **Contact**

#### **Corporate Office:**

Tube Investments of India Ltd.
"Dare House", 234 N S C Bose Road,
Chennai- 600 001, India.

**\*** +91 44 42177770

**4** +91 44 42110404

⊠ info@tii.murugappa.com