

Action plan Dt.: 30 JUN 2022

CONDITIONS FOR OCCURRENCE



• Phenomenon: Total length u/s

Supplier: Saptagiri Industries

Model: K0LA

Parts name: Inner TubePart No.: S1GD01726B

- Date of Occurrence: 30. 06.2022

• **Qty NG**: 01 Nos.

Parts Stock check results

Action

NG Part	OK Part
Specification: 173.3 ±0.2 mm	

 
Trouble content

 
Area	Total Stock	Checked	Checking Method	NG Qty	Status			
ETL Narsapura	3000	3000	Check	0	All available stock qty.			
					verified & found OK.			

UNDERSTANDING OF ACTUAL CONDITION AND CONTROL



Process Flow






UNDERSTANDING OF ACTUAL CONDITION



Understanding the actual cause – (Factor analysis)

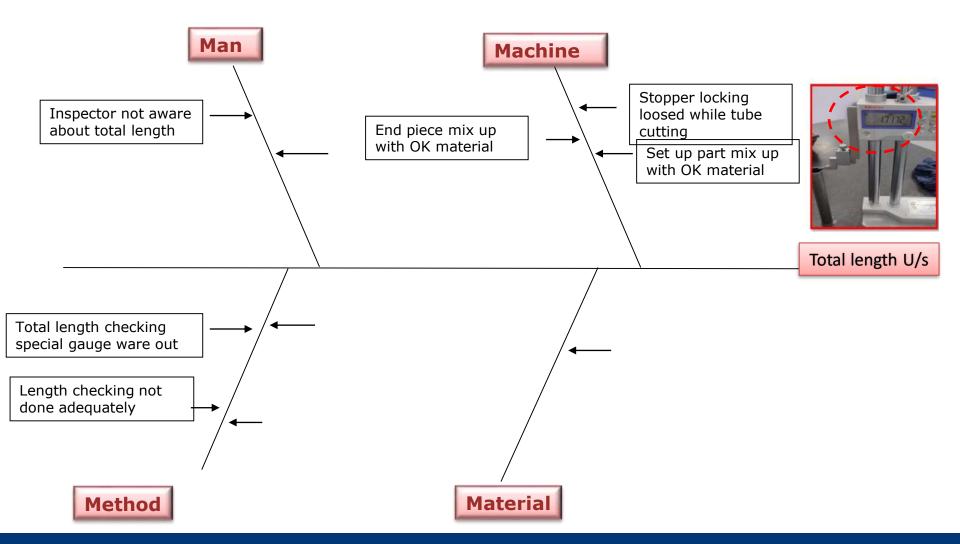

FACTS VERIFICATION



			Correction year	20/20/20/20/20
#	4M	PROBABLE CAUSES	FACTS VERIFICATION	Jud.
1	MAN	Inspector not aware about total length	Operator and inspector nor a aware about the total length special gauge and its operating	Δ
		Set up part mix up with OK material	Red bin with lock and key it's missing at the machine	Δ
2	MACHINE	End piece mix up with OK material	For storing end pieces one gunny bag available with identified	О
		Stopper locking loosed while tube cutting	Not loosed the stopper while tube cutting	О
		Total length checking special gauge ware out	Gauge verified by height gauge and its observed ok	О
3	METHOD	Length checking not done adequately	Length checking done adequality	О
				О
	MATERIAL			О
4				О

ROOT CAUSE ESTABLISHMENT

(WHY-WHY ANALYSIS)



Root cause establishment (Why-Why Analysis)

	WHY – 1	WHY- 2	WHY -3	WHY-4	Why-5	Why-6
Occurrence	Total length U/s	Set up part mix up with OK material	Set up part storing bin missing	No Lock & Key for storing set up or rejected parts		
Outflow	Total length U/s	Operator not aware about total length				

Conclusion

]	N	o]	Locl	< &	z k	Cey	for	storing	set	up	or	reject	ed	parts
---	---	-----	------	-----	-----	-----	-----	---------	-----	----	----	--------	----	-------

☐ Operator not aware about total length

COUNTERMEASURES



				replete sociations
	Cause	Countermeasure	Tgt. Dt.	Status
		• 1) Provide Lock & key Rejection storage bin.	30-06-2022	Completed
Supplier End		• 2)Awareness Training given to concern operator & Inspector	30-06-2022	Completed
	<occurrence></occurrence>	• 3) Make SOP for Tube Cutting operation & its verification	30-06-2022	Completed
		4) Provide the stopper slot on chamfer machine	30-06-2022	Completed
pı		• 1) Started 100% inspection for length verification.	30-06-2022	Completed
Supplier / ETL End	<outflow></outflow>	2) Verify Gauge Length.	30-06-2022	Completed

Countermeasure taken



Operation: Chamfer Target date: 02.08.2022

Short length tube

Ok length tube




 Gap in-between stoppers' slot and tube




 No Gap in-between stoppers' slot and tube

OPL FOR TOTAL LENGTH VERIFICATION:



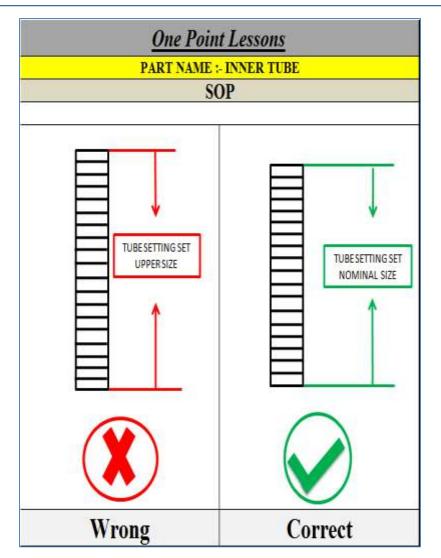


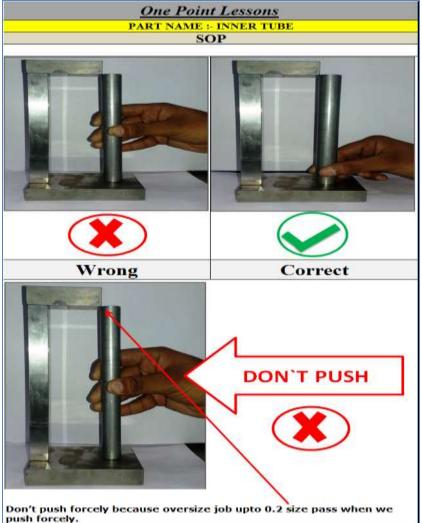




OPERATOR TRAINING RECORD:



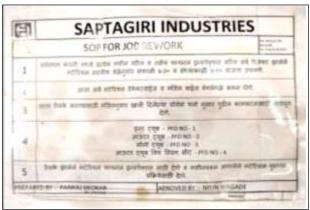

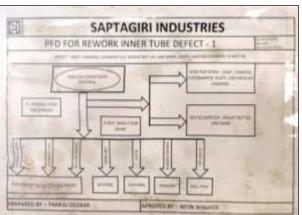

Made SOP of rework for the tube defects , Awareness training given to concern operator



Made SOP for Tube cutting stage , Awareness training given to concern operator



Lock & Key bin provided at cutting machine for storing set up, & Rejected parts



Provide the slot on chamfer machine as a poka yoke, If short length tube insert, It will not clamp and fall down at the below





THANK YOU