JZ/JH RR Complaint- Flash on lens edge Date- 06.05.2023



UNO MINDA

H105 HL- inside noise

Action Details



Date: 06/05/2023

Year	Quarter	Issue related to – Write Which is applicable		Vendor Name	Part name/ BAL Part No.	Vehicle model	Rej Qty	Detectable /non detectable	Cause Related to – Tick (V) Which is applicable		Action details - Tick (V) Which is applicable	
2023-24	Q1	EFR		Minda Industries	JH/JZ reflex reflector	All	20	Detectable	Inspection		Reactive	\checkmark
		Warranty		Rinder division				Process	\checkmark	Pro active		
		NCR/PIS/ <mark>QSR</mark> /Export(IRU)						Design				
		IPO Audit							Jig/Fixture/Tooling/design		Distinctly Ahead	


Customer complaint :

SN	Defect Phenom ena	Root Cause	Corrective / Restoring action (4M1T conditions)	Preventive & Detection actions	Tgt Date	Status	Sustenance action	System action
1	Flash on lens edge	the part & cutter while de-gating. Why 3 - Gap due curved shape cutter used (inconsistency in gate cutting).	 WI made & displayed at work station to use Plier plastic cutter nipper 152 mm-6 STANLEY cutter. Q-Alert displayed & awareness training given to operators 	 Check point started at final stage by hand feeling at gate cutting area to ensure no flash . Check point added during PDI inspection 	09.05.23		Check point during in process inspection	FPA updated

Defect Details

Y


UNO MINDA

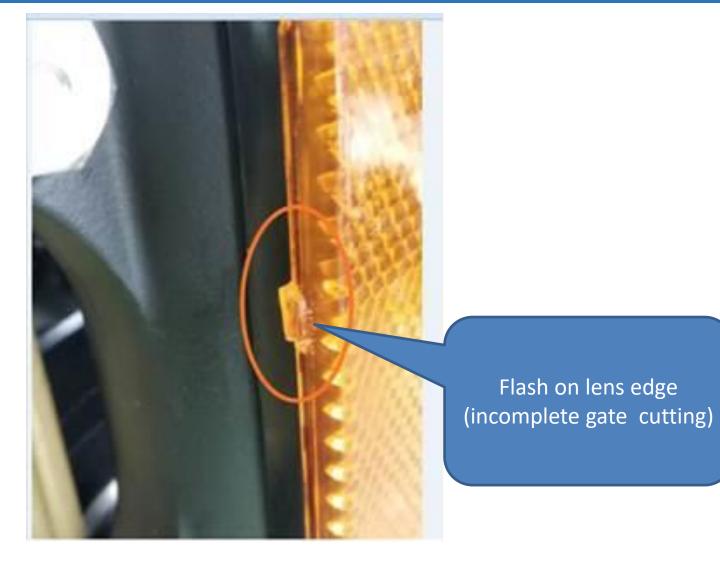

Corrective Action					
Before	After				
	<image/>				
Curved shape cutter used for lens gate cutting, observed inconsistency in lens gate cutting (man to man variation)	Plier nipper 152 mm-6 STANLEY cutter provided for easy lens gate cutting to operator				

Q-Alert Displayed



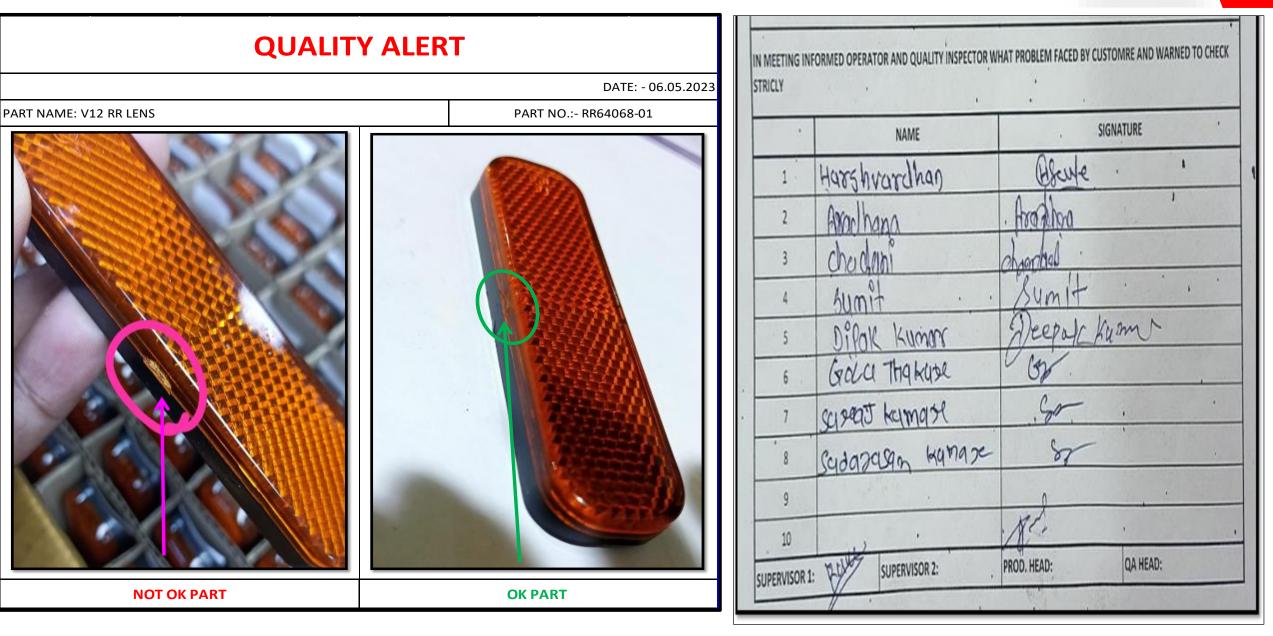



Thank You

For more information/clarification on contents of presentation

For more details on the Company Visit <u>www.unominda.com</u>



